
Tri-ang Anlunys




POWER BOGIES-R.55, R.155, R.159, R.253


Replaces Servicing Sheet No. 12 for models produced from 1st January, 1959

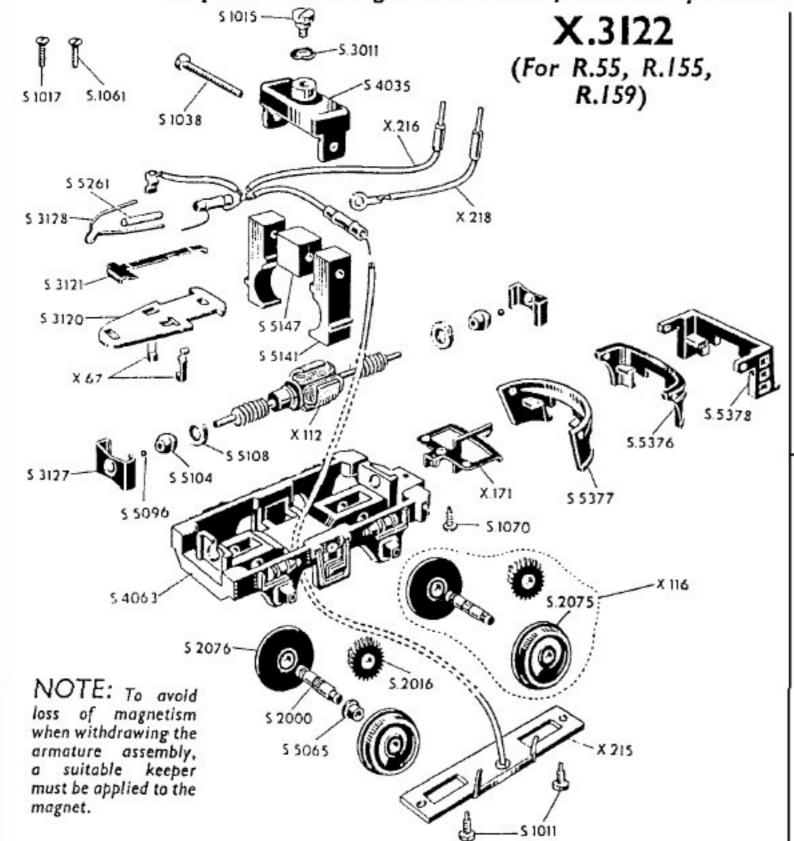


X.3166 (For R.253)
Other Parts as for X.3122

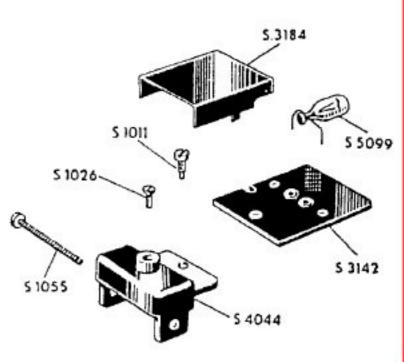

LAMP BRACKET R.55

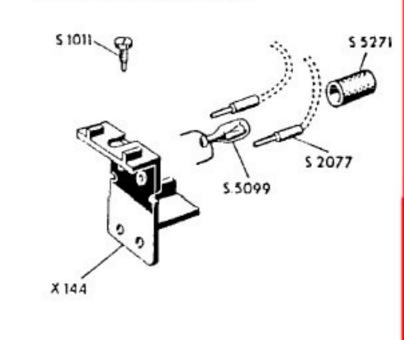

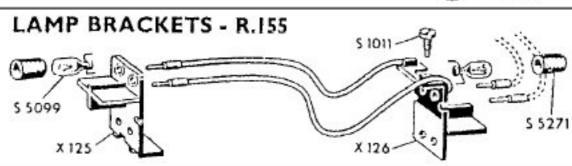

WINDOW & LAMP HOUSING UNITS - R.159



	-2-4-0.000				
X.3122	Power Bogie (Mk. 3 Coupling) for R.55, R.155, R.159	X.218	Lamp Lead with Plug and Tag Washer	S.3120 S.3121	Brush Gear Diaphragm Brush Gear Return Spring
X.3166	Power Bogie (Mk. 3 Coupling) for R.253	S.1011	Securing Screw for Collector, etc.	S.3127 S.3128	Spring Clip Brush Spring
X.67	Brush Arm and Brush	S.1015	Pivot Pin for Power Bogie	5.3142	Lamp Diaphragm
X.112	Armature Assembly (including	S.1017	Body/Chassis Securing Screw	5.3184	Lamp Shield
	commutator and worms)		for R.55, R.155	5.4035	Pivot Bracket
X.116	Axle Assembly for T.C. Power	S.1026	Body Securing Screw for R.253	S.4044	Top Mounting Bracket
	Bogies X.3122 and X.3166	S.1038	Magnet Screw	S.4063	Main Frame Casting
	(comprising \$.2075, \$.2076,	S.1055	Magnet Screw	5.5065	Insulating Bush
	S.2016, S.2000)	5.1061	Roof Securing Screw for R.159	S.5096	Thrust Ball
X.125	Lamp Bracket (floor mounting)	5.1070	Coupling Screw (10")	5.5099	Headlamp Bulb
X.126	Lamp Bracket with Leads	5.2000	Knurled Driving Axle	S.5104	Spherical Bearing
X.144	Lamp Bracket (top mounting)	5.2016	Worm Wheel (26 Teeth)	5.5108	Felt Lubricating Pad
X.153	Window and Lamp Housing	S.2075	Bushed Wheel (large) for	5.5141	Pole Piece
X.154	Window and Lamp Housing	3.2073	Power Bogie	S.5147	Magnet
	with Leads	S.2076	Unbushed Wheel (large) for	5.5261	Insulating Sleeve
X.171	Mk. 3 Coupling Unit	3.2070	Power Bogie	5.5271	Headlamp Sleeve
X.215	Collector Arm and Fibre with	S.2077	Lamp Plug	S.5376	Pilot for R.55
	Lead	5.3011	Pivot Pin Washer for R.55,	5.5377	Pilot for R.159
X.216	T.V. Suppressors with Leads	3.3011	R.155	S.5378	Pilot for R.155
	and Lamp Plug		11.133	3.3310	Thou for IC.133

For Non-powered Bogie see Servicing Sheet No. 5a

Modifications are made to Tri-ang Railways models from time to time. If a spare part is required which does not coincide with the illustration, a full description should be given and, if necessary, a sketch or sample should accompany the order.



PRINTED IN ENGLAND